

Service

Category Engine/Hybrid System

Section Engine Mechanical Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2006	GS300	Body Type(s): 4Dr. Sedan Drive Type(s): 2WD, 4WD Engine(s): 3GR Transmission(s): 6AT VDS(s): BH96S, CH96S	

TSIB SUPERSESSION NOTICE

The information contained in this TSIB supersedes TSIB No. EG016-07.

- The OFPs have been updated in the Warranty Information table.
- Part numbers for the Camshaft Timing Gear Assembly have been updated in the Parts Information table.

TSIB No. EG016-07 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this service bulletin before proceeding.

Introduction

Immediately following a cold soak startup, some 2006 model year GS 300 vehicles may exhibit a brief rattle/knock noise from the engine compartment for approximately one second. Refer to the repair procedure below to address customer concerns.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EG7027	R & R Bank 1 & Bank 2 Intake Camshaft Gear Assembly	6.0	13050-3104# 13050-31120	06	40

APPLICABLE WARRANTY

- This repair is covered under the Lexus Powertrain Warranty. This warranty is in effect for 72 months or 70,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to correction of a problem based upon a customer's specific complaint.

L-SB-0152-08 October 27, 2008 Page 2 of 47



Brief Engine Knock/Rattle Noise at Cold Startup

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
13050-31040			
13050-31041	13050-31121	Gear Assembly, Camshaft Timing	2
13050-31120			
90430-16012	Same	Cooket Oil Bine	4
90430-16016	Same	Gasket, Oil Pipe	
11328-31030	Same	Gasket, Timing Gear Cover	1
11159-31010	11159-0P010	Cooket Comphett Bearing Con	4
90430-10024	90430-A0001	Gasket, Camshaft Bearing Cap	2
23915-46011	Same	Insulator, Fuel Pump	1
11214-31020	Same	Gasket, Cylinder Head Cover No. 2	1
11213-31040	Same	Gasket, Cylinder Head Cover	1
17176-31020	Same	Gasket, Air Surge Tank to Intake Manifold	1

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
TIS Techstream*	ADE	TODICOA	4
NOTE: Software version 4.00.017 or later is required.	ADE	TSPKG1	1

^{*} Essential SST.

NOTE

Additional TIS Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

TOOLS & MATERIAL	QTY
Toyota Genuine Adhesive 1344, Three Bond 1344, or Equivalent	As Needed
FIPG Sealant: P/N 08826-00080, or Equivalent	As Needed


Repair Procedure: Disassembly

1. Disconnect the cable from the negative (–) battery terminal.

Repair Procedure: Disassembly (Continued)

2. Remove the cool air intake duct seal by removing the 7 clips.


Figure 1.

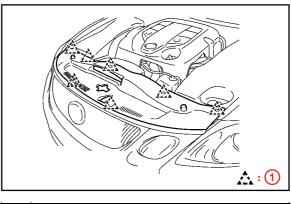

1 Clip

3. Remove the engine compartment side cover RH by removing the nut and 2 clips.


Figure 2.

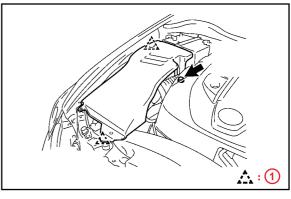

1 Clip

4. Remove the engine compartment side cover LH by removing the 3 clips.

Figure 3.

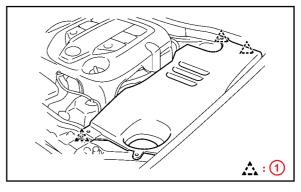

1 Clip


L-SB-0152-08 October 27, 2008 Page 4 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

- 5. Remove the V-bank cover sub-assembly.
 - A. Raise the V-bank cover to disengage the clip on the rear of the cover.

Figure 4.

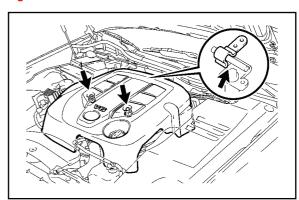

B. Raise the cover again to remove the 2 nuts on the front of the cover and remove the cover.

NOTE

Attempting to disengage the rear clip and remove the 2 nuts at the same time may cause the cover to break.

6. Discharge the fuel system pressure.

FUEL SYSTEM CAUTIONS:

- Do NOT smoke or work near an open flame when working on the fuel system.
- Keep gasoline away from rubber or leather parts.
- Do NOT allow fuel to spray when removing the pipe between the high pressure side fuel pump and the fuel injector. The fuel in the pipe is highly pressurized.
- Wear safety goggles while working with the fuel system under pressure.
- Do NOT disconnect any part of the fuel system until you have discharged the fuel system pressure.
- Even after discharging the fuel pressure, place a shop rag over fittings as you separate them to reduce risk of fuel spray on yourself or in the engine compartment.


L-SB-0152-08 October 27, 2008 Page 5 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

A. Disconnect the fuel pump connector.

Figure 5.

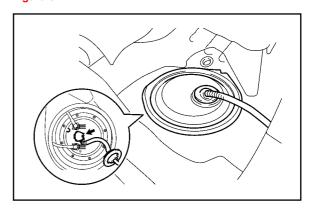


- B. Connect the cable to the negative (-) battery terminal.
- C. Start the engine. After the engine has stopped on its own, turn the engine switch OFF.

HINT

DTC P0171/P0172 (System Too Lean) may be set.

- D. Crank the engine again, and then check that the engine does NOT start.
- E. Loosen the fuel tank cap to discharge the pressure in the fuel tank completely.
- F. Reconnect the fuel pump connector.
- G. Disconnect the cable from the negative (–) battery terminal.
- 7. Remove the No. 1 inlet air cleaner by removing the bolt and clip.

Figure 6.

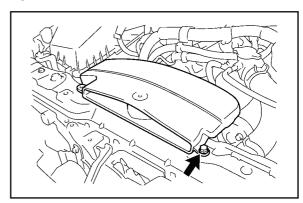


L-SB-0152-08 October 27, 2008 Page 6 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)


8. Disconnect the ventilation hose from the cylinder head.

Figure 7.

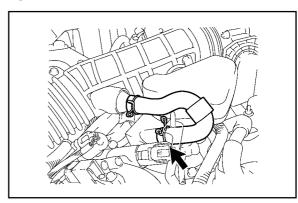


- 9. Remove the air cleaner cap with air cleaner hose.
 - A. Disconnect the MAF meter connector.
 - B. Disconnect the clamp from the air cleaner.
 - C. Disconnect the EVAP VSV.

Figure 8.

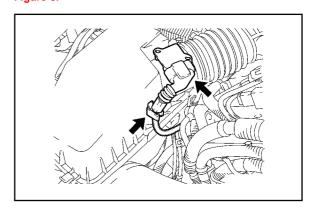

D. Loosen the hose clamp and air cleaner cap with air cleaner hose.

Figure 9.

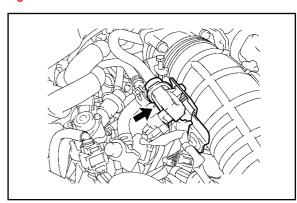


L-SB-0152-08 October 27, 2008 Page 7 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)


10. Remove the air cleaner case sub-assembly by removing the 3 bolts.

Figure 10.

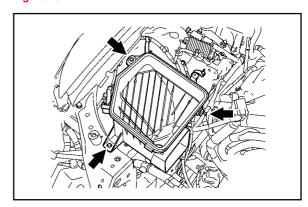


- 11. Disconnect the union to check valve hose by removing the clamp.
- 12. Disconnect the No. 2 fuel vapor feed hose by removing the clamp.

Figure 11.

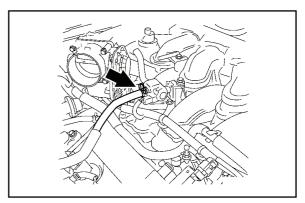

13. Disconnect the fuel main tube.

Figure 12.

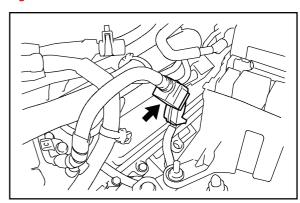

L-SB-0152-08 October 27, 2008 Page 8 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

- 14. Remove the throttle body assembly (with motor).
 - A. Disconnect the throttle motor connector.
 - B. Remove the 4 bolts and disconnect the throttle body from the intake surge tank.

HINT

Do NOT disconnect the water bypass hose.

15. Remove the intake air surge tank assembly.


NOTE

Cover the top surface of the intake manifold with duct tape (or equivalent) to prevent foreign material from falling into the engine.

- A. Disconnect the vacuum hose from the intake air surge tank.
- B. Remove the bolt and disconnect the No. 1 vacuum switching valve assembly from the intake air surge tank.

Figure 14.

Figure 13.

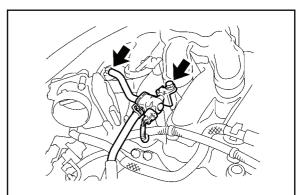


October 27, 2008 Page 9 of 47 L-SB-0152-08

Brief Engine Knock/Rattle Noise at Cold Startup


Repair Procedure: Disassembly (Continued)

C. Disconnect the wire harness and hose from the surge tank.


Figure 15.

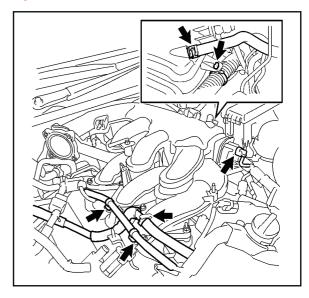

D. Disconnect the ventilation hose from the intake Figure 16. air surge tank.

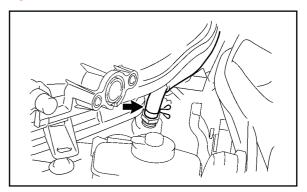

E. Remove the bolt and water hose joint from the intake air surge tank.

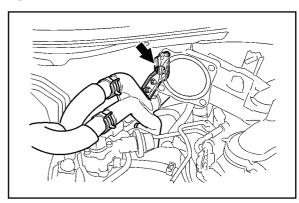


L-SB-0152-08 October 27, 2008 Page 10 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


Repair Procedure: Disassembly (Continued)

F. Remove the bolt and disconnect the surge tank stay.

Figure 18.

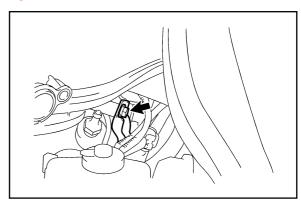

- G. Using a 5-mm hexagon socket wrench, remove the 7 bolts, 2 nuts, and gasket.
- 16. Remove fuel pipe No. 1.
 - A. Disconnect the No. 3 fuel hose from the No. 1 fuel pipe.

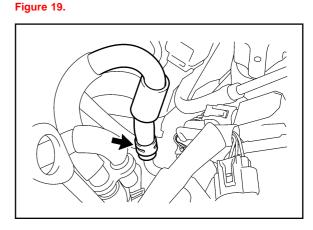

B. Disconnect the 2 fuel hoses.


L-SB-0152-08 October 27, 2008 Page 11 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

C. Remove the 2 bolts and No. 1 fuel pipe.

Figure 20.

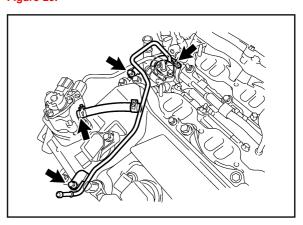


- 17. Disconnect the No. 2 fuel pipe.
 - A. Disconnect the fuel high pressure side fuel pump connector.
 - B. Secure the union bolt in place on the fuel pump side with a 21-mm wrench. Using a 19-mm union nut wrench, loosen the union and remove the fuel pipe.

NOTE

- There must be absolutely NO free play in the union on the fuel pump side.
- If the union on the fuel pump side has free play, replace the fuel pump.

Figure 21.

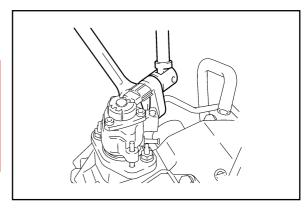


C. Remove the 2 bolts on the delivery pipe side.

NOTE

- Do NOT remove the fuel pipe from the delivery pipe. ONLY remove the 2 bolts.
- If the No. 2 fuel pipe <u>is</u> accidentally removed, replace its O-ring, No. 1 backup ring, and No. 2 backup ring.

Figure 22.

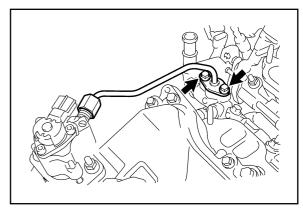

L-SB-0152-08 October 27, 2008 Page 12 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


Repair Procedure: Disassembly (Continued)

- 18. Remove the fuel pump assembly.
 - A. Remove the 2 nuts, 2 stud bolts, and fuel pump.
 - B. Remove the fuel insulator from the cylinder head cover.

NOTE


- To keep the nipple joint for the fuel pipe free of foreign matter, cover with a plastic bag.
- Remove the engine oil out of the oil pool from the cylinder head cover's fuel pump attachment hole.
- 19. Remove the ignition coil assemblies.
- 20. Remove the No. 1 oil pipe union bolt from the oil pipe.

Figure 23.

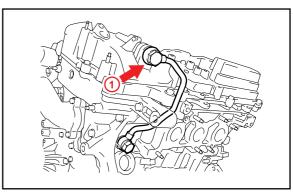

1 Oil Pipe Union

21. Remove No. 2 oil pipe union bolt from the oil pipe.

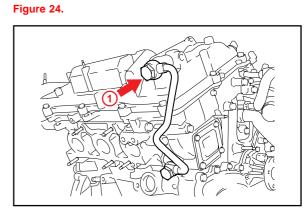

Oil Pipe Union

L-SB-0152-08 October 27, 2008 Page 13 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


Repair Procedure: Disassembly (Continued)

- 22. Remove the cylinder head cover LH.
 - A. Remove the 12 bolts, oil seal washer, and cylinder head cover.

NOTE


- Cover the hole around the timing chain with shop rags to prevent foreign material from falling into the engine.
- The baffle plate is located on the back of the portion shown in the illustration.
- Do NOT damage the baffle plate when removing the cylinder head cover.
- B. Remove the cylinder head cover gasket from the cylinder head cover.
- C. Remove the 3 gaskets.

Figure 25.

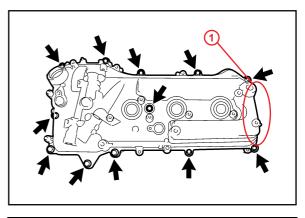

Baffle Plate

Figure 26.

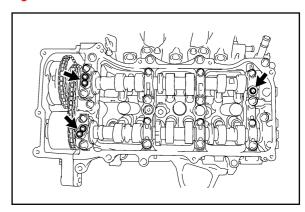

L-SB-0152-08 October 27, 2008 Page 14 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

- 23. Remove the cylinder head cover RH.
 - A. Remove the 12 bolts, 2 oil seal washers, and cylinder head cover.

NOTE

- Cover the hole around the timing chain with shop rags to prevent foreign material from falling into the engine.
- The baffle plate is located on the back of the portion shown in the illustration.
- Do NOT damage the baffle plate when removing the cylinder head cover.
- B. Remove the cylinder head cover gasket from the cylinder head cover.
- C. Remove the 3 gaskets.

Figure 27.


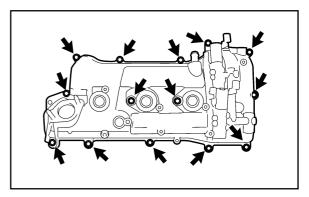


Figure 28.

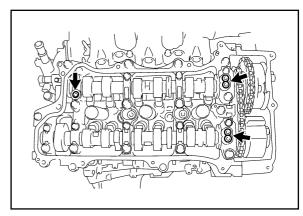


L-SB-0152-08 October 27, 2008 Page 15 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)


24. Remove engine cover No. 1 by removing the 3 clips.

Figure 29.

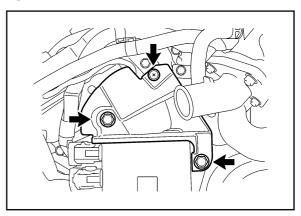


25. Remove the injector driver by removing the bolt and 2 nuts.

Figure 30.

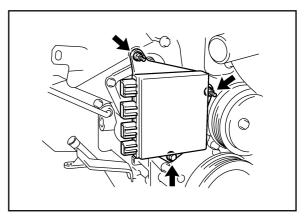

26. Remove the timing chain cover plate by removing the 4 bolts, timing chain cover plate, and timing chain cover plate gasket.

Figure 31.

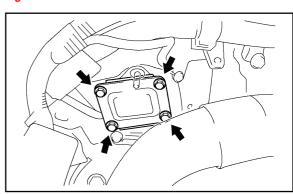

L-SB-0152-08 October 27, 2008 Page 16 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

LEXUS

- 27. Set the No. 1 cylinder to TDC/compression.
 - A. Set the timing mark to 0° on the timing chain cover by rotating the crankshaft clockwise.
 - B. Check that the timing marks of the camshaft timing gear assembly are aligned with the timing marks of the camshaft bearing cap.

HINT


If the timing marks are NOT aligned, turn the crankshaft one revolution (360°) clockwise and align the timing marks.

C. Using a paint marker, mark the sprocket wheel, timing mark of the camshaft timing gear assembly, and the timing chain itself.

HINT

Wipe any oil off before marking.

Figure 32.

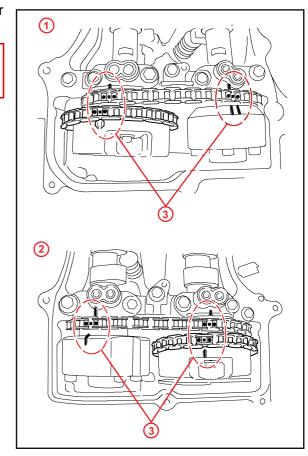

1	LH Bank Side
2	RH Bank Side
3	Paint Marks

L-SB-0152-08 October 27, 2008 Page 17 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

) LEXUS

- 28. Remove the chain tensioner assembly No. 1.
 - A. Loosen tension from the timing chain by rotating the crankshaft 30° counterclockwise.


HINT

The procedure above is to prevent the valve and piston from hitting each other when turning the crankshaft.

B. Remove the 2 bolts and No. 1 chain tensioner assembly.

HINT

Do NOT drop the No. 1 chain tensioner assembly and bolts inside the timing chain cover.

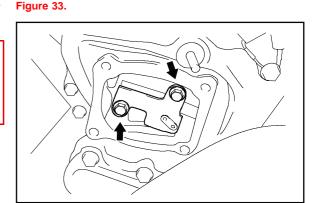

29. Remove the timing chain.

A. LH bank:

(1) Loosen tension from the timing chain by rotating the crankshaft.

HINT

Oil may spray out of the holes on top of the No. 3 camshaft bearing cap when rotating the crankshaft. Use shop rags to prevent any spray.

(2) Remove the timing chain from the timing gear and rest it on the camshaft timing gear assembly temporarily.

B. RH bank:

(1) Loosen tension from the timing chain by rotating the crankshaft.

NOTE

Oil may spray out of the holes on top of the No. 1 camshaft bearing cap when rotating the crankshaft. Use shop rags to prevent any spray.

L-SB-0152-08 October 27, 2008 Page 18 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


Repair Procedure: Disassembly (Continued)

- (2) Rotate the crankshaft clockwise until the flat surface of the timing exhaust gear assembly faces the vertical position.
- (3) Remove the timing chain from the timing gear and rest it on the camshaft timing gear assembly temporarily.
- 30. Remove the camshaft bearing cap.

A. RH bank:

(1) Check that the camshafts are in the neutral position shown in the illustration.

Figure 34.

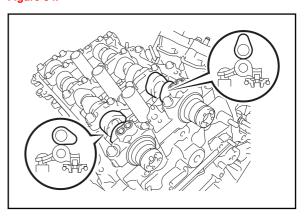


(2) Uniformly loosen and remove the 9 camshaft bearing cap M6 bolts in the sequence shown in the illustration.

HINT

Keep the camshaft horizontal while loosening the bearing cap bolts.

Figure 35. M6 Loosening Sequence

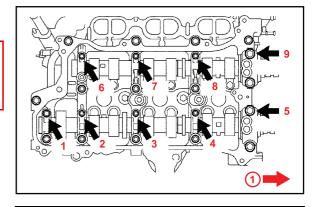

1 Front


L-SB-0152-08 October 27, 2008 Page 19 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

(3) Uniformly loosen and remove the 9 camshaft bearing cap M8 bolts in the sequence shown in the illustration.

Figure 36. M8 Loosening Sequence

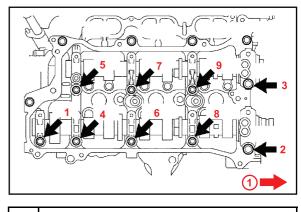


1 Front

(4) Remove the 6 camshaft bearing caps.

B. LH bank:

(1) Check that the camshafts are in the neutral position shown in the illustration.

Figure 37.

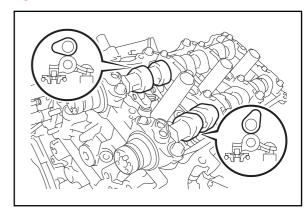

EXUS L-SB-0152-08 October 27, 2008 Page 20 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


Repair Procedure: Disassembly (Continued)

(2) Uniformly loosen and remove the 8 camshaft bearing cap M6 bolts in the sequence shown in the illustration.

HINT

Keep the camshaft horizontal while loosening the bearing cap bolts.


Figure 38. M6 Loosening Sequence

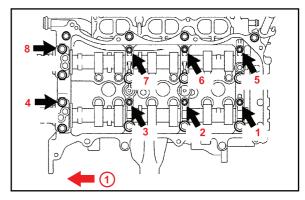

1 Front

(3) Uniformly loosen and remove the 8 camshaft bearing cap M8 bolts in the sequence shown in the illustration.

Figure 39. M8 Loosening Sequence

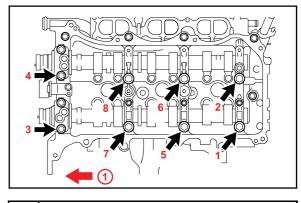

1 Front

(4) Remove the 5 camshaft bearing caps.


L-SB-0152-08 October 27, 2008 Page 21 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)


- 31. Remove the No. 2 camshaft.
 - A. Remove the bolt for the No. 2 chain tensioner assembly.

Figure 40.

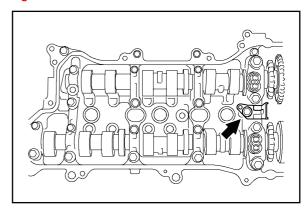

- B. While holding No. 2 camshaft, remove the No. 2 chain tensioner assembly.
- C. While holding the No. 2 chain, slide the No. 2 camshaft out toward the front of the vehicle.

Figure 41.

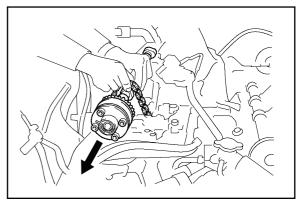

- 32. Remove the No. 1 camshaft.
 - A. Hold the rear portion of the No. 1 camshaft (with tilt position).
 - B. Hold the timing chain from the timing gear, and slide the No. 1 camshaft (with No. 2 chain) out toward the rear of the vehicle.

NOTE


Keep tension on the timing chain to avoid separation from the crankshaft timing gear.

L-SB-0152-08 October 27, 2008 Page 22 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Disassembly (Continued)

C. Tie the timing chain to the oil pipe with a strap. Figure

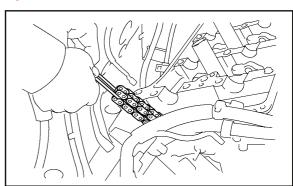


- 33. Remove camshaft No. 4.
 - A. Remove the bolt for the No. 3 chain tensioner assembly.
 - B. While holding the No. 4 camshaft, remove the No. 3 chain tensioner assembly.
 - C. Hold the No. 2 chain, and slide the No. 4 camshaft out toward the front of the vehicle.
- 34. Remove camshaft No. 3.
 - A. Hold the rear portion of the No. 3 camshaft (with tilt position).
 - B. Remove the timing chain from the timing gear, and slide the No. 3 camshaft (with the No. 2 chain) out toward the rear of the vehicle.

NOTE

Keep tension on the timing chain to avoid separation from the crankshaft timing gear.

Figure 43.

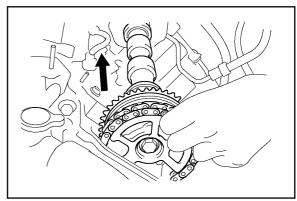


- C. Tie the timing chain to the oil pipe with a strap.
- 35. Remove and replace the Bank 1 intake camshaft gear assemblies.
 - A. Clamp the hexagonal portion of the camshaft in a vice and remove the bolt.
 - B. Install the NEW intake camshaft gear assemblies and torque the bolt.
 Torque: 100 N*m (1020 kgf*cm, 74 ft*lbf)
 - C. Repeat for the Bank 2 intake camshaft gear assembly.

Repair Procedure: Reassembly

- 1. Install the No. 3 camshaft.
 - A. Align the mark plate (yellow) of the No. 2 chain with the timing marks of the camshaft timing gear assembly shown in the illustration.
 - B. Clean the camshaft journals and apply engine oil.


Figure 44.

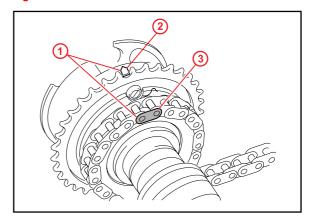

1	Align
2	Timing Mark
3	Mark Plate (Yellow)

C. Make sure that the valve rocker arms are installed with the lash adjuster and valve stem cap properly as shown in the illustration.

Figure 45.

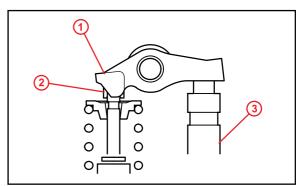

1	Valve Rocker Arm
2	Valve Stem Cap
3	Valve Lash Adjuster




Repair Procedure: Reassembly (Continued)

D. Temporarily put the timing chain to the No. 3 camshaft on the camshaft timing gear assembly and place the No. 3 camshaft on the camshaft housing LH.

NOTE

- Temporarily put the timing chain on the camshaft timing gear assembly without installing to the sprocket.
- Place the camshaft as the timing mark faces on the top.


Figure 46.

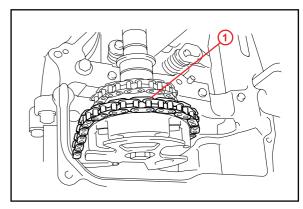

Put Chain on Timing Gear

- 2. Install the No. 1 camshaft using the same procedure as step 1.
- 3. Install the No. 4 camshaft.
 - A. Clean the camshaft journals and apply engine oil to them.
 - B. Hold the No. 2 chain and slide the No. 4 camshaft in from the front of the vehicle.
 - C. Align the mark plate (yellow) with the timing marks of the camshaft timing exhaust gear LH.

Figure 47.

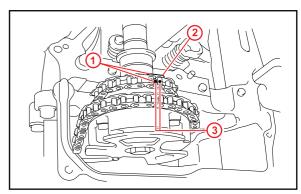

1	Align Marks
2	Mark Plate
3	Paint Marks

L-SB-0152-08 October 27, 2008 Page 25 of 47


Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Reassembly (Continued)

D. Hold the No. 2 chain and install the No. 3 chain tensioner assembly.

Torque: 21 N*m (214 kgf*cm, 15 ft*lbf)

Figure 48.

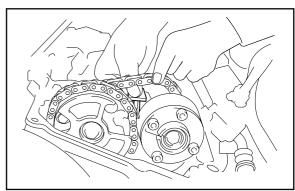


- 4. Install the No. 2 camshaft using the same procedure as step 3.
- 5. Install the camshaft bearing cap.

A. LH bank:

- (1) Clean the camshaft bearing caps and apply engine oil.
- (2) Make sure that the valve rocker arms are properly installed with each lash adjuster and valve stem cap.
- (3) Make sure of the marks and numbers on the camshaft bearing caps and temporarily tighten the 16 bolts.

Figure 49.

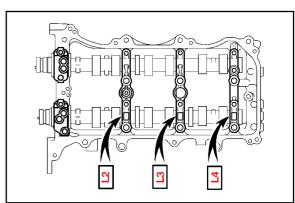

L-SB-0152-08 October 27, 2008 Page 26 of 47


Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Reassembly (Continued)

(4) Tighten the 8 M6 bolts in the sequence shown.

Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)

Figure 50. M6 Torque Sequence

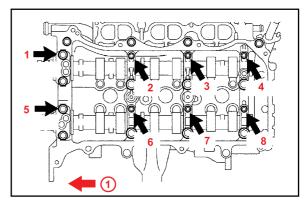


1 Front

(5) Tighten the 8 M8 bolts in the sequence shown.

Torque: 28 N*m (286 kgf*cm, 21 ft*lbf)

Figure 51. M8 Torque Sequence

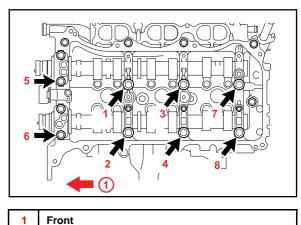

(6) Tighten the 8 M6 bolts to their final torque value in the sequence shown in Figure 50. Torque: 16 N*m (163 kgf*cm, 12 ft*lbf)

B. RH bank:

- (1) Clean the camshaft bearing caps and apply engine oil.
- (2) Make sure that the valve rocker arms are properly installed with each lash adjuster and valve stem cap.


L-SB-0152-08 October 27, 2008 Page 27 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Reassembly (Continued)

(3) Make sure of the marks and numbers on the camshaft bearing caps and temporarily tighten the 16 bolts.


Figure 52.

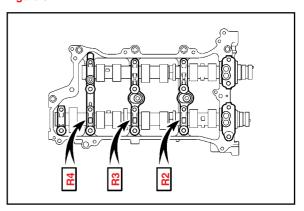

(4) Tighten the 9 M6 bolts in the sequence shown in the illustration.

Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)

Figure 53. M6 Torque Sequence

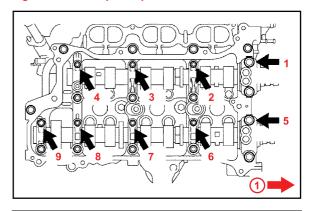


1 Front

(5) Tighten the 9 M8 bolts in the sequence shown in the illustration.

Torque: 28 N*m (286 kgf*cm, 21 ft*lbf)

Figure 54. M8 Torque Sequence

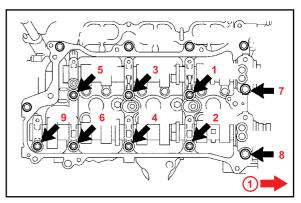

1 Front

L-SB-0152-08 October 27, 2008 Page 28 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Reassembly (Continued)

LEXUS

(6) Tighten the 9 M6 bolts to their final torque value in the sequence shown in Figure 53. Torque: 16 N*m (163 kgf*cm, 12 ft*lbf)

6. Install the timing chain.

A. LH bank:

Align the mark plate (yellow) of the timing chain with the timing marks of the camshaft timing gear assembly and install to the sprocket.

NOTE

If the paint mark is NOT aligned, turn the crankshaft slightly to adjust the position.


B. RH Bank:

 Align the mark plate (yellow) of the timing chain with the timing marks of the camshaft timing gear assembly and install to the sprocket.

NOTE

If the paint mark is NOT aligned, turn the crankshaft and adjust one notch each as shown in the illustration.

Figure 55.

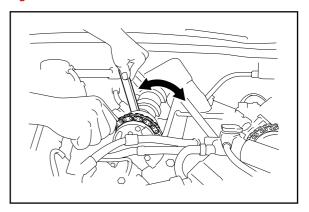


- (2) Set the No. 1 cylinder to TDC/compression, by aligning the timing mark to 0° on the timing chain cover by rotating the crankshaft counterclockwise.
- (3) Slightly turn the crankshaft and loosen tension for the timing chain where the No. 1 chain tensioner is attached.

Repair Procedure: Reassembly (Continued)

- 7. Install the No. 1 chain tensioner assembly.
 - A. Move the stopper plate upward to release the lock, and push the plunger deep into the tensioner.


Figure 56.

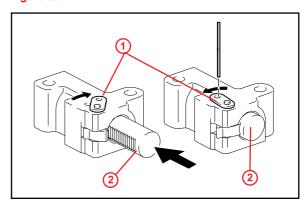

1	Stopper Plate
2	Plunger

- B. Move the stopper plate downward to set the lock, and insert a hexagon wrench into the hole of the stopper plate.
- C. Install the No. 1 chain tensioner assembly with Figure 57. the 2 bolts.

Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)

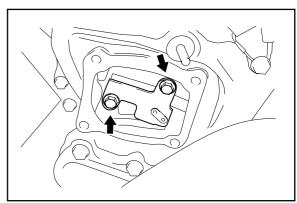


EXUS L-SB-0152-08 October 27, 2008 Page 30 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Reassembly (Continued)

D. Remove the lock pin of the No. 1 chain tensioner assembly. Check that each timing mark is aligned with the crankshaft at the TDC/compression.

Figure 58.

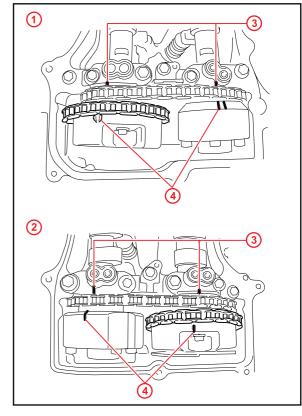

1	LH Bank Side
2	RH Bank Side
3	Timing Marks
4	Paint Marks

E. Turn the crankshaft 2 rotations and double-check that each timing mark is positioned properly.


October 27, 2008 Page 31 of 47 L-SB-0152-08

Brief Engine Knock/Rattle Noise at Cold Startup

Repair Procedure: Reassembly (Continued)


8. Install the NEW gasket and the timing chain cover Figure 59. plate with the 4 bolts.

Torque: 9 N*m (93 kgf*cm, 7 ft*lbf)

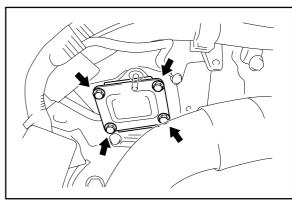


9. Install the injector driver with the bolt and 2 nuts. Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)

Figure 60.

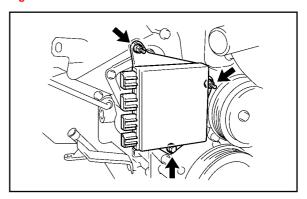

10. Install the No. 1 engine cover with the 3 clips.

Figure 61.

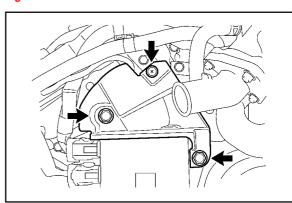




Repair Procedure: Reassembly (Continued)

- 11. Install the cylinder head cover RH.
 - A. Apply FIPG sealant as shown in the illustration. Figure 62. FIPG sealant: P/N 08826-00080 (or equivalent)


NOTE

- Remove any oil from the contact surface.
- Install the head cover within 3 minutes after applying the FIPG sealant.
- Do NOT start the engine for at LEAST 2 hours after installing.
- B. Install 3 NEW gaskets as shown in the illustration.

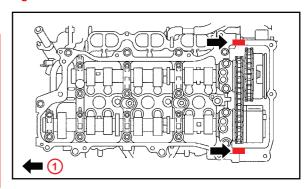

FIPG Sealant

Figure 63.

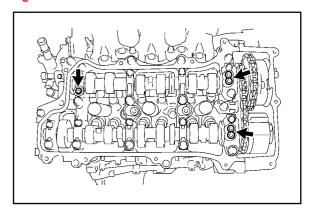

- C. Install a NEW gasket to the head cover.
- D. Install the head cover with the 14 bolts.

Torque: Bolts A:


21 N*m (214 kgf*cm, 15 ft*lbf)

Torque:

Bolts except A:

10 N*m (102 kgf*cm, 7 ft*lbf)

Figure 64.

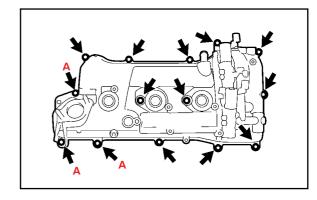




Repair Procedure: Reassembly (Continued)

- 12. Install the cylinder head cover LH.
 - A. Apply FIPG sealant as shown in the illustration. Figure 65. FIPG sealant: P/N 08826-00080 (or equivalent)


NOTE

- Remove any oil from the contact surface.
- Install the head cover within 3 minutes after applying the FIPG sealant.
- Do NOT start the engine for at LEAST 2 hours after installing.
- B. Install 3 NEW gaskets as shown in the illustration.

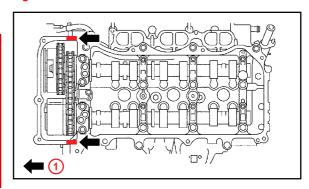

FIPG Sealant

Figure 66.

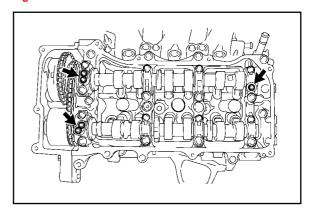

- C. Install a NEW gasket to the head cover.
- D. Install the head cover with the 12 bolts.

Torque: Bolts A:


21 N*m (214 kgf*cm, 15 ft*lbf)

Torque:

Bolts except A:

10 N*m (102 kgf*cm, 7 ft*lbf)

Figure 67.

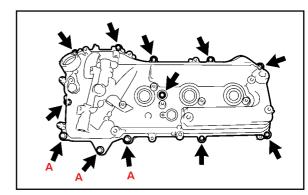



Repair Procedure: Reassembly (Continued)


E. For 4WD:

Install the engine hanger with the 2 bolts. Torque: 33 N*m (337 kgf*cm, 24 ft*lbf)

13. Install the oil pipe union bolt to the No. 2 oil pipe.

Torque: 60 N*m (612 kgf*cm, 44 ft*lbf)

Figure 68.

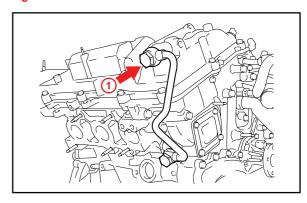


1 Oil Pipe Union

14. Install the oil pipe union bolt to the No. 1 oil pipe.

Torque: 60 N*m (612 kgf*cm, 44 ft*lbf)

Figure 69.

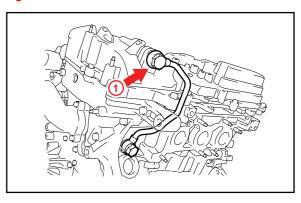

1 Oil Pipe Union


15. Install the ignition coil assemblies.



Repair Procedure: Reassembly (Continued)

- 16. Install the fuel pump assembly.
 - A. Turn the crankshaft until the flat of the cam is facing the cylinder head cover fuel pump attachment hole as shown in the illustration.
 - B. Pour 30 cc of engine oil into the cylinder head oil collector through the cylinder head cover fuel pump attachment hole.

Figure 70.

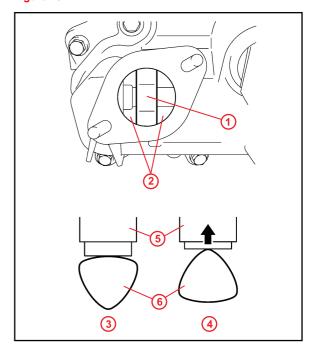

1	Camshaft
2	Oil Collector
3	CORRECT
4	INCORRECT
5	Pump
6	Cam


L-SB-0152-08 October 27, 2008 Page 36 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

DLEXUS

C. Apply a coat of engine oil to the pump activation cam and pump lifter.

Figure 71.

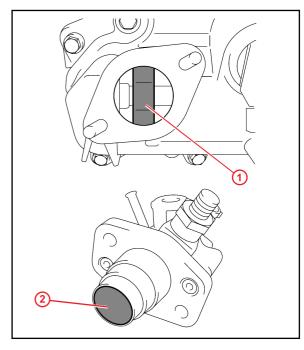


1	Camshaft
2	Pump Lifter

D. Install the NEW fuel insulator to the cylinder head cover.

NOTE

The open sides of the metal eyelets must be facing upward as shown in the illustration.

Figure 72.

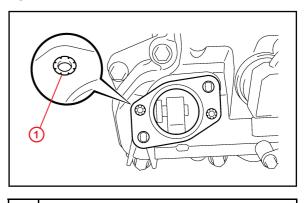

1 Metal Eyelets

L-SB-0152-08 October 27, 2008 Page 37 of 47


Brief Engine Knock/Rattle Noise at Cold Startup

E. Temporarily install the No. 2 fuel pipe sub-assembly to the fuel pump assembly.

NOTE

Be careful NOT to damage the sealing surface of the fuel pipe when temporarily installing the fuel pipe.

Figure 73.

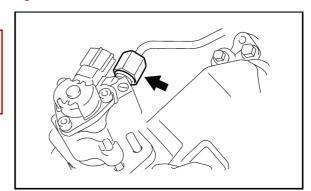


F. Install the 2 studs.

Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)

G. Install the 2 nuts and tighten them in several passes.

Torque: 25 N*m (255 kgf*cm, 18 ft*lbf)

Figure 74.

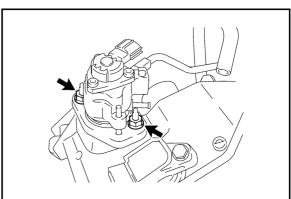


H. Connect the fuel hose.

- 17. Connect the No. 2 fuel pipe.
 - A. Install the No. 2 fuel pipe to the delivery pipe with the 2 bolts.

Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)


Figure 75.

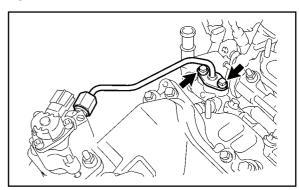

B. Using a 19-mm union nut wrench, connect the fuel pipe.

Torque: 30 N*m (306 kgf*cm, 22 ft*lbf)


Figure 76.

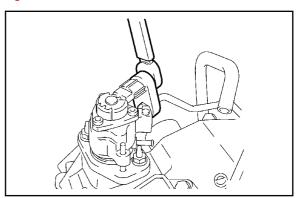

- C. Connect the connector to the fuel pump.
- 18. Install the No. 1 fuel pipe.
 - A. Install the No. 1 fuel pipe with the 2 bolts.

 Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)
 - B. Connect the 2 fuel hoses.

Figure 77.

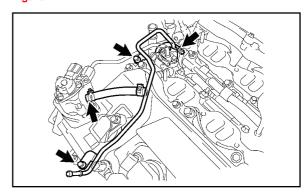

- 19. Connect the fuel main tube.
- 20. Install the air surge tank assembly.
 - A. Install a NEW gasket to the intake air surge tank.

L-SB-0152-08 October 27, 2008 Page 39 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


B. Using a 5-mm hexagon socket wrench, install the 6 bolts.

Torque:

Bolts except A:

18 N*m (184 kgf*cm, 13 ft*lbf)

Figure 78.

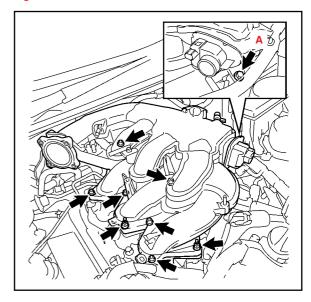

C. Install the bolt and 2 nuts to the intake air surge tank.

Torque:

Bolt A: 21 N*m (214 kgf*cm, 15 ft*lbf)

Torque:


Nut: 16 N*m (163 kgf*cm, 12 ft*lbf)

D. Install the surge tank stay to the intake air surge tank.

Torque:

Nut: 21 N*m (214 kgf*cm, 15 ft*lbf)

Figure 79.

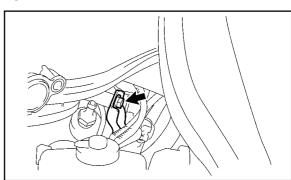


L-SB-0152-08 October 27, 2008 Page 40 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


E. Connect the water hose joint with the bolt.Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)

Figure 80.

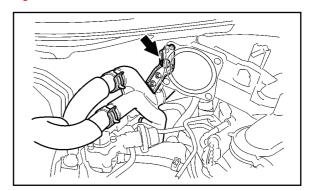


F. Connect the ventilation hose to the intake air surge tank.

Figure 81.

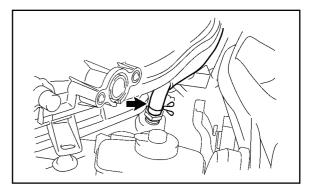

G. Connect the wire harness and hose to the intake air surge tank.

Figure 82.

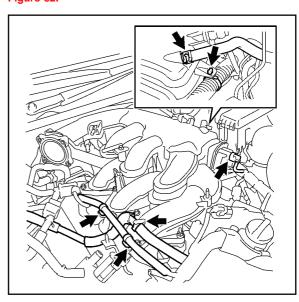


L-SB-0152-08 October 27, 2008 Page 41 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

H. Connect the No. 1 vacuum switching valve assembly to the intake air surge tank.

Torque: 18 N*m (184 kgf*cm, 13 ft*lbf)

Figure 83.

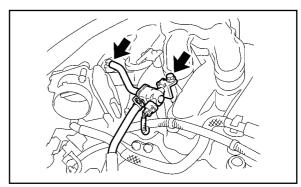


- I. Connect the vacuum hose to the intake air surge tank.
- 21. Install the throttle body assembly (with motor).
 - A. Install a NEW gasket to the intake air surge tank.

NOTE

- Align the protrusion of the gasket on the intake air surge tank.
- Make sure the direction of the gasket is as shown in the illustration.

Figure 84.

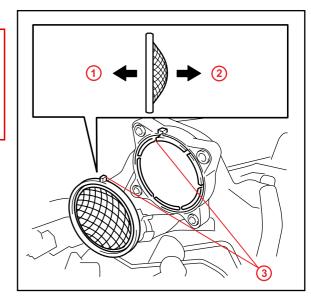

1	Throttle Body Assembly Side
2	Intake Air Surge Tank Side
3	Align


L-SB-0152-08 October 27, 2008 Page 42 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

B. Install the throttle body with the 4 bolts.

Torque: 10 N*m (102 kgf*cm, 7 ft*lbf)


Figure 85.

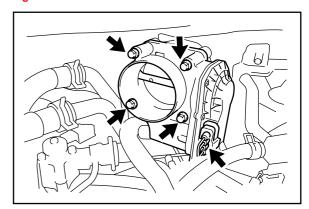

- C. Connect the throttle body connector.
- 22. Connect the No. 2 fuel vapor hose.

Install the clamp and connect the No. 2 fuel vapor feed hose.


Figure 86.

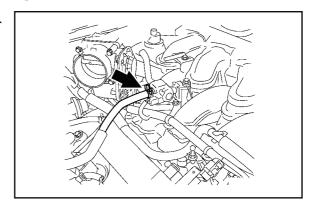

- 23. Connect the union to check valve hose to the surge tank.
- 24. Install the air cleaner case sub-assembly, clamp, and 2 bolts.

Torque: 5.0 N*m (51 kgf*cm, 44 in*lbf)

Figure 87.

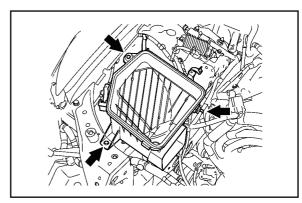


L-SB-0152-08 October 27, 2008 Page 43 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


- 25. Install the air cleaner cap with air cleaner hose.
 - A. Install the air cleaner cap with air cleaner hose assembly with the hose clamp.
 - B. Install the EVAP VSV to the air cleaner hose.

Figure 88.

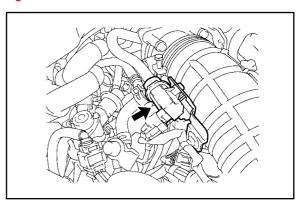


C. Connect the MAF meter connector and clamp to the air cleaner.

Figure 89.

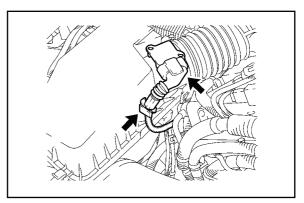

26. Connect the ventilation hose from the cylinder head.

Figure 90.

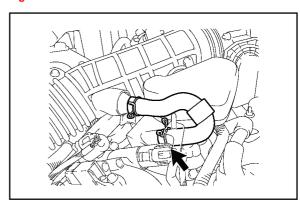

L-SB-0152-08 October 27, 2008 Page 44 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

27. Install the No. 1 air cleaner inlet with the bolt and clip.

Figure 91.

28. Connect the cable to the negative (–) battery terminal.

Torque: 5.4 N*m (55 kgf*cm, 48 in*lbf)

- 29. Check for fuel leaks.
 - A. Connect TIS Techstream to DLC3.

NOTE

Switch OFF all accessories and A/C before connecting the Techstream tester.

- B. Turn the engine switch ON (IG). Do NOT start the engine.
- C. Enter the following menus:

Powertrain / Engine / Active Test / FUEL PUMP / SPD.

D. Check for fuel leaks.

Check that there are NO fuel leaks anywhere in the system. If there is a fuel leak, repair or replace parts as necessary.

- 30. Check for engine oil leaks.
- 31. Check the ignition timing.
 - A. Warm up the engine and then stop the engine.

NOTE

A warmed up engine should have an engine coolant temperature of over 176°F (80°C), have an engine oil temperature of 140°F (60°C), and the engine rpm should be stabilized.

B. Start the engine and maintain engine rpm at idle speed.

(L) L-SB-0152-08 October 27, 2008 Page 45 of 47

Brief Engine Knock/Rattle Noise at Cold Startup

C. Enter the following menus on TIS Techstream:

Powertrain / Engine / Data List / IGN ADVANCE.

Ignition timing: 5 to 15° BTDC at idle

HINT

Refer to the TIS Techstream Help menu for further details.

- D. Check that ignition timing advances as engine speed increases.
- 32. Check engine idle speed.
 - A. Warm up and then stop the engine.

NOTE

A warmed up engine should have an engine coolant temperature of over 176°F (80°C), have an engine oil temperature of 140°F (60°C), and the engine rpm should be stabilized.

- B. Raise the engine speed to 2,500 rpm for approximately 90 seconds, and then return to idle.
- C. Enter the following menus:

Powertrain / Engine / Active Test / ENGINE SPD.

Idle speed: 650 to 750 rpm

NOTE

When checking the idle speed, the transmission should be in Neutral or Park.

HINT

- Refer to the TIS Techstream Help menu for further details.
- If the idle speed is NOT as specified, check the air intake system.
- D. Clear all DTCs.
- E. Disconnect TIS Techstream from DLC3.
- 33. Check the engine oil level.

Stop the engine, and wait 5 minutes. The oil level should be between the dipstick's low level mark and full level mark. If low, check for leakage and add oil up to the full level mark.

L-SB-0152-08 October 27, 2008 Page 46 of 47

Figure 92.

Brief Engine Knock/Rattle Noise at Cold Startup


34. Install the V-bank cover sub-assembly.


Install the 2 nuts on the front of the cover, and then engage the clip on the rear to install the V-bank cover.

NOTE

- Be sure to engage the clip securely.
- Do NOT apply excessive force or hit the cover to engage the clip. This may cause the cover to break.
- 35. Install the engine compartment side cover RH with the 2 clips and nut.

Figure 93.

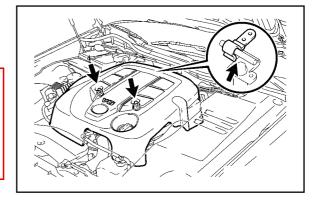


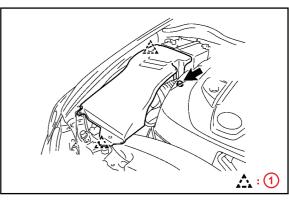

1 Clip

36. Install the engine compartment side cover LH with the 3 clips.

Figure 94.

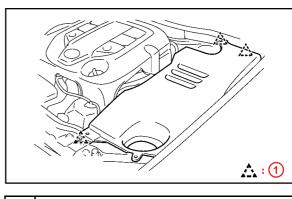


1 Clip

L-SB-0152-08 October 27, 2008 Page 47 of 47

Brief Engine Knock/Rattle Noise at Cold Startup


37. Install the cool air intake duct seal with the 7 clips. Figure 9

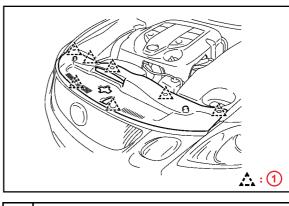

1 Clip

- 38. Check throttle body function and throttle control motor operating sounds.
 - A. Turn the engine switch ON (IG).
 - B. When pressing the accelerator pedal, check the operating sound of the running motor. Make sure that NO friction noises emit from the motor. If friction noise exists, replace the throttle body.

Figure 96.

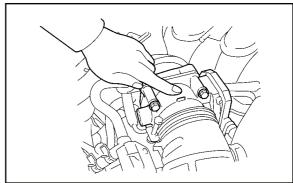

- 39. Re-initialize any affected power systems.
 - Refer to TSIB No. PD009-06, "Power System Initialization During PDS."
- 40. Road test to verify repair.