

Subject		Market
Abnormal 1-2 and/or 2-3 Shift after Transaxle Replacement or Engine Repair		USA
Service Category	Section	
Drivetrain	Automatic Transmission/Transaxle	
Applicability		
1999-2003 RX300		

APPLICABLE VEHICLES

1999-2003	RX300
-----------	-------

CONDITION

- Customer states the transaxle is not shifting correctly after transaxle/engine repair.
- The 1-2 and/or 2-3 shifts are slipping or shuddering.

RECOMMENDATIONS

- Confirm the EC Ground is correctly fastened to the rear side of the air intake chamber assembly as shown below.
- If the EC Ground was incorrectly fastened to the valve cover or left loose, these shifting concerns will occur.

