



**Technical Service
Information Bulletin**

October 1, 1999

Title:
M.I.L. "ON" DTC P1133
Models:
'99 RX 300

T S I B

REVISÉD
EG005-99
ENGINE

Introduction Under certain driving conditions, some 1999 model year RX 300's may exhibit a M.I.L. "ON" DTC P1133. An improved Air/Fuel Ratio Sensor has been developed to address this condition.

**Production
Change
Information**

MODEL	ENDING VIN
1999 RX 300 (2WD)	JT6GF10U*X0039830
1999 RX 300 (4WD)	JT6HF10U*X0085162

“*” May be any number from 0 to 9 or an X.

**Parts
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
89467-48010	89467-48011	Air/Fuel Sensor (RX 300)

**Repair
Procedure**

- Should a M.I.L. "ON" condition with DTC P1133 be encountered, perform diagnostic procedures as described in the Repair Manual.
- If the problem source cannot be identified after checking all affected areas according to the Repair Manual, the cause may be an Air/Fuel Ratio Sensor malfunction. In this case, replace the Air/Fuel Ratio Sensor with the updated part.
- If the Exhaust Manifold threads are damaged by removal of sensor, they can be repaired by the proper use of a M18 x 1.5 Tap.

**Warranty
Information**

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
EL9006	R & R Air/Fuel Ratio Sensor	.2	89467-48010	99	99

Applicable Warranty*:

This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

NOTE:

Please enter the DTC P1133 in the Condition/Cause/Remedy Section when applying for Warranty Reimbursement.

