

# Totus Ltd

is quality Service for your Cars

## Diagnostic REPORT by al tech page

<b>Customer Name</b>	n / a			<b>Phone</b>	n / a		
<b>Address</b>	n / a			<b>Vehicle Type</b>	Truck ( MCU35L- )		
<b>Color</b>	1C0	<b>Model</b>	RX 300	<b>Year</b>	2005	<b>Engine</b>	1MZ-FE VVT-i 3.0 L
<b>Mileage</b>	1068 km	<b>VIN</b>	JTJHF31U502004440	<b>License Plate</b>	-		
<b>Hour</b>	09:22	<b>Date</b>	14/07/2005	<b>Made By</b>	TOYOTA MOTOR ENGINEERING EUROPE SA/NV		

"Check Engine" Lamp ON. EOBD DTC P0346 {Camshaft Position Sensor ("A") / VVT Sensor - Circuit Range/Performance (Bank 2)}

1. Oil Control Valve operation, Signal Wavvform, resistance, circuit - O'k
2. VVT Sensor operation, resistance, circuit - O'k
3. Check Valve Timing - O'k
4. Check blockage of OCV - O'k

Off. Above Vehicle have bad Catalytic Convertor (Bank2)

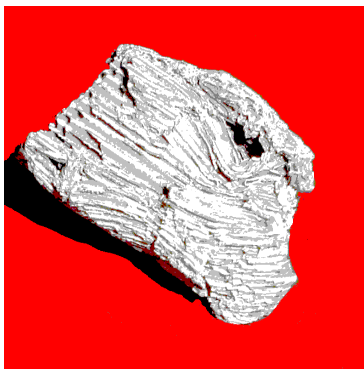


Figure 1

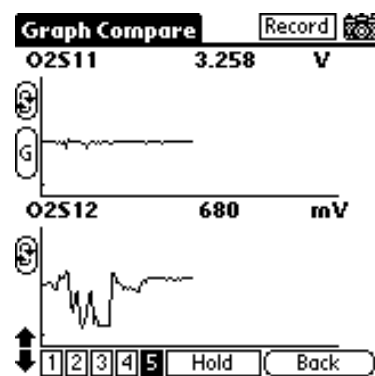


Figure 2

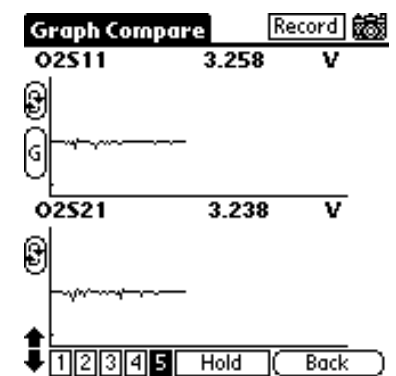


Figure 3

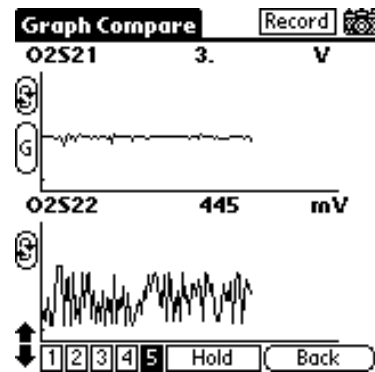


Figure 5

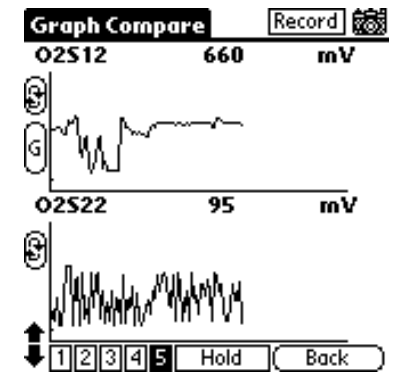


Figure 6